

Abbreviated Field Sampling Plan for Remedial Investigation/Feasibility Study Oversight San Jacinto River Waste Pits Superfund Site Harris County, Texas EPA Identification No. TXN000606611

Remedial Action Contract 2 Full Service Contract: EP-W-06-004 Task Order: 0130-RSBD-06ZQ

Prepared for

U.S. Environmental Protection Agency Region 6 1445 Ross Avenue Dallas, Texas 75202-2733

Prepared by

EA Engineering, Science, and Technology, Inc., PBC 405 S. Highway 121
Building C, Suite 100
Lewisville, Texas 75067
(972) 315-3922

December 2015 Revision: 00 EA Project No. 14342.130

Abbreviated Field Sampling Plan for Remedial Investigation/Feasibility Study Oversight San Jacinto River Waste Pits Superfund Site Harris County, Texas EPA Identification No. TXN000606611

Remedial Action Contract 2 Full Service Contract: EP-W-06-004 Task Order: 0130-RSBD-06ZQ

Jim Slants

22 December 2015

Tim Startz, P.M.P. EA Program Manager Date

Lh, P.E. P.G. Ph.D.

22 December 2015

Frank Barranco, Ph.D., P.E., P.G. EA Quality Assurance Officer

Date

Gary Miller
U.S. Environmental Protection Agency Region 6 Task Order Monitor

Date

1. PROJECT DESCRIPTION AND ORGANIZATION

This Abbreviated Field Sampling Plan (FSP) has been prepared to detail sample management procedures associates with the splitting of samples with the Potentially Responsible Party's (PRP) consultant. EA will be only responsible for the labeling of sample containers, the packing of samples for shipment, completion of a chain-of-custody, and delivery of the samples to Test America Laboratories, Inc. At no time, will EA collect actual samples or conduct activities as performed by the PRP's consultant, as this FSP only covers the items previously listed.

1.1 SPECIAL TRAINING AND CERTIFICATION

This section outlines the training and certification required to complete the activities described in this FSP and describes the requirements for the field team working onsite.

1.1.1 Health and Safety Training

EA field team personnel who work at hazardous waste project sites are required to meet the Occupational Safety and Health Administration (OSHA) training requirements defined in 29 Code of Federal Regulations (CFR) 1910.120(e). These requirements include: (1) 40 hours of formal offsite instruction, (2) a minimum of 3 days of actual onsite field experience under the supervision of a trained and experienced field supervisor, and (3) 8 hours of annual refresher training. Field personnel who directly supervise employees engaged in hazardous waste operations also receive at least 8 additional hours of specialized supervisor training.

Copies of the field team's health and safety training records, including course completion certifications for the initial and refresher health and safety training, and specialized supervisor training are maintained in project files.

Before work begins at a specific hazardous waste project site, EA personnel are required to undergo site-specific training that thoroughly covers the following areas:

- Names of personnel and alternates responsible for health and safety at a hazardous waste project site
- Health and safety hazards present onsite
- Selection of the appropriate personal protective equipment (PPE)
- Correct use of PPE
- Work practices to minimize risks from hazards
- Safe use of engineering controls and equipment onsite
- Medical surveillance requirements, including recognition of symptoms and signs that might indicate overexposure to hazardous substances.

December 2015

For more health and safety details, see EA's site-specific Health and Safety Plan short form (EA 2015).

1.2 DOCUMENTS AND RECORDS

The following sections discuss the requirements for documenting field activities and for preparing laboratory data packages. This section also describes reports that will be generated as a result of this project.

1.2.1 Field Documentation

Field personnel will use permanently bound field logbooks with sequentially numbered pages to record and document field activities and will follow Field Technical Procedures and Guidelines, standard operating procedure (SOP) 016 (Appendix A). The logbook will list the contract name and number; Site name; and names of subcontractors, service client, and project manager. At a minimum, the following information will be recorded in the field logbook:

- Name and affiliation of all onsite personnel or visitors,
- Weather conditions during the field activity,
- Summary of daily activities and significant events,
- Notes of conversations with coordinating officials,
- References to other field logbooks or forms that contain specific information,
- Discussions of problems encountered and their resolution,
- Discussions of deviations from the FSP or other governing documents, and
- Description of all photographs taken.

1.2.2 Laboratory Documentation

The following documentation will be required for full data validation, if applicable:

- Case narratives, which will describe all quality control (QC) non-conformances that are encountered during the analysis of samples in addition to any corrective actions that are taken; the following information will be provided:
 - Statement of samples received
 - Description of any deviations from the specified analytical method
 - Explanations of data qualifiers that are applied to the data
 - Any other significant problems that were encountered during analysis
- Tables that cross-reference field and laboratory sample numbers;
- Chain-of-custody forms, which pertain to each sample delivery group or sample batch that is analyzed;

- Laboratory reports, which must show traceability to the sample analyzed and must contain the following specified information:
 - Project identification
 - Field sample number
 - Laboratory sample number
 - Dates and times of sample collection, receipt at the laboratory, preparation, and analysis
 - Description of analytical method and reference citation
 - Results of individual parameters, with mass units, and other confirmatory results, where appropriate
 - Quantitation limits achieved
 - Dilution or concentration factors
- Data summary forms and QC summary forms showing analytical results, if applicable, will contain the following information:
 - Samples
 - Surrogates
 - Blanks
 - Field QC samples
 - LCS
 - Initial and continuing calibrations
 - Other QC samples.

1.2.3 Reports Generated

EA will prepare a letter report documenting field activities fourteen (14) days after receiving final laboratory reports.

2. DATA GENERATION AND ACQUISITION

This section describes the requirements for the following:

- Sample handling and custody (Section 2.3)
- Analytical methods (Section 2.4)
- Quality control requirements (Section 2.5)
- Data acquisition requirements (Section 2.9)
- Data management (Section 2.10).

2.1 SAMPLING METHODS

This section describes the procedures for sample container labels, COC preparation, sample packaging and shipping, sample preservation, and container type. Table 1 lists the SOPs that will be implemented during this field program. SOPs are provided in Appendix A.

TABLE 1. STANDARD OPERATING PROCEDURES

SOP Number	SOP Title				
001	Labels				
002	Chain-of-Custody Form				
004	Sample Packing and Shipping				
005	Field Decontamination				
039	Sample Preservation and Container Requirements				

2.2 SAMPLE HANDLING AND CUSTODY

Each sample provided to EA by the PRP's consultant will be traceable from the point of relinquishment to EA from the PRP's consultant through analysis to ensure sample integrity. Sample integrity helps to ensure the legal defensibility of the analytical data and subsequent conclusions. EA will not be utilizing EPA's data management system known as "Scribe" to produce all COC records in the field as the split samples will be analyzed by a private laboratory. EA will utilize the form provided by the laboratory.

2.2.1 Sample Documentation

Documentation during sampling is essential to ensure proper sample identification. EA personnel will adhere to the following general guidelines for maintaining field documentation:

- Documentation will be completed in permanent black ink; however, chains-of-custody will be signed in blue ink;
- All entries will be legible;
- Errors will be corrected by crossing out with a single line and then dating and initialing the lineout
- Any serialized documents will be maintained at EA and referenced in the Site logbook
- Unused portions of pages will be crossed out, and each page will be signed and dated.

The EA field team leader is responsible for ensuring that sampling activities are properly documented.

2.2.1.1 Sample Labels

A sample label will be affixed to each sample container. The label will be completed with the following information written in indelible ink:

- Project name and location
- Sample identification number
- Date and time of sample collection

- Sample collector's initials
- Analysis required.

2.2.1.2 Chain-of-Custody

EA will use standard sample custody procedures to maintain and document sample integrity during collection, transportation, storage, and analysis. A sample will be considered to be in custody if one of the following statements applies:

- It is in a person's physical possession or view
- It is in a secure area with restricted access
- It is placed in a container and secured with an official seal such that the sample cannot be reached without breaking the seal.

Chain-of-custody procedures provide an accurate written record that traces the possession of individual samples from the time of collection in the field to the time of acceptance at the laboratory. Information that the field personnel will record on the chain-of-custody record includes:

- Project name and number
- Sampling location
- Name and signature of sampler
- Sample identification number
- Date and time of collection
- Analysis requested
- Signatures of individuals involved in custody transfer, including the date and time of transfer
- Airbill number (if applicable)
- Project contact and phone number.

Unused lines on the chain-of-custody record will be crossed out. Field personnel will sign chain-of-custody records that are initiated in the field, and the airbill number will be recorded. The record will be placed in a waterproof plastic bag and taped to the inside of the shipping container used to transport the samples. Signed airbills will serve as evidence of custody transfer between field personnel and the courier, and between the courier and the laboratory. Copies of the chain-of-custody record and the airbill will be retained and filed by field personnel before the containers are shipped.

The following procedures will be implemented when samples collected during this project are shipped:

- The shipping box will be filled with bubble wrap, sample bottles, and packing material.
 Sufficient packing material will be used to prevent sample containers from breaking during shipment.
- The chain-of-custody records will be placed inside a plastic bag. The bag will be sealed and taped to the inside of the cooler lid. The airbill, if required, will be filled out before the samples are handed over to the carrier. The laboratory will be notified if the sampler

December 2015

suspects that the sample contains any substance that would require laboratory personnel to take safety precautions.

- The shipping box will be closed and taped shut with strapping tape around both ends.
- Signed and dated custody seals will be placed on the front and side of each shipping box. Wide clear tape will be placed over the seals to prevent accidental breakage.
- The chain-of-custody record will be transported within the taped sealed shipping box.
 When the shipping box is received at the analytical laboratory, laboratory personnel will open the shipping box and sign the chain-of-custody record to document transfer of samples.

2.3 ANALYTICAL METHODS

EA will use EPA-approved methods for laboratory analyses of the split sediment samples. Split sediment samples will be analyzed for dioxins and furans.

2.3.1 Laboratory Analytical Methods

Fixed laboratory analyses will be conducted by the non-team subcontractor, TestAmerica in their West Sacramento, California laboratory. All samples submitted to the analytical laboratory will be analyzed via EPA Method 8290 or EPA 1613B. Final decision on the appropriate analytical method will be discussed with the EPA Task Order Monitor and the PRP's consultant.

Appendix A EA Standard Operating Procedures



Standard Operating Procedure No. 001 for Sample Labels

Prepared by

EA Engineering, Science, and Technology, Inc. 11019 McCormick Road Hunt Valley, Maryland 21031

CONTENTS

		<u>Page</u>
1.	SCOPE AND APPLICATION	.1
2.	MATERIALS	.1
3.	PROCEDURE	.1
	3.1 Label Information	.2
	3.3.1 Logbook Entry	.2
	3.4 Shipment	.3
4.	MAINTENANCE	.3
5.	PRECAUTIONS	.3
	5.1 Incidental Odors5.2 Duplicate Sample	
6.	REFERENCES	.3



1. SCOPE AND APPLICATION

The purpose of this Standard Operating Procedure is to delineate protocols for the use of sample labels. Every sample will have a sample label uniquely identifying the sampling point and analysis parameters. An example label is provided below. Other formats with similar levels of detail are acceptable.

PROJECT NAME PROJECT NUM
SAMPLE LOCATION/SITE ID
DATE:/ TIME::
ANALYTES: METALS VOC EXPLOSIVES ORGANICS OTHER
FILTERED: [NO] [YES]
PRESERVATIVE: [NONE] [HNO ₃] [OTHER]
SAMPLER:

2. MATERIALS

The following materials may be required: sample label and indelible laboratory marker.

3. PROCEDURE

The following sections describe how to use the sample labeling system.

3.1 LABEL INFORMATION

As each sample is collected/selected, fill out a sample label. Enter the following information on each label:

- Project name
- Project number
- Location/site identification—Enter the media type (i.e., well number, surface water, soil, etc.) sampling number, and other pertinent information concerning where the sample was taken
- Date of sample collection



- Time of sample collection
- Analyses to be performed (NOTE: Due to number of analytes, details of analysis should be arranged with laboratory *prior to start of work*)
- Whether filtered or unfiltered (water samples only)
- Preservatives (water samples only)
- Number of containers for the sample (e.g., 1 of 2, 2 of 2).

3.2 ROUTINE CHECK

Double-check the label information to make sure it is correct. Detach the label, remove the backing, and apply the label to the sample container. Cover the label with clear tape, ensuring that the tape completely encircles the container.

3.3 RECORD INFORMATION

Record the sample number and designated sampling point in the field logbook, along with the following sample information:

- Time of sample collection (each logbook page should be dated)
- Location of the sample
- Organic vapor meter or photoionization meter readings for the sample (when appropriate)
- Any unusual or pertinent observations (oily sheen on groundwater sample, incidental odors, soil color, grain size, plasticity, etc.)
- Number of containers required for each sample
- Whether the sample is a quality assurance sample (split, duplicate, or blank).

3.3.1 Logbook Entry

A typical logbook entry might look like this:

- 7:35 a.m. Sample No. MW-3. PID = 35 ppm
- Petroleum odor present. Sample designated MW-3-001.



NOTE: Duplicate samples will be given a unique sample designation rather than the actual sample number with an added prefix or suffix. This will prevent any indication to the laboratory that this is a duplicate sample. This fictitious sample number will be listed in the logbook along with the actual location of the sample.

3.4 SHIPMENT

Place the sample upright in the designated sample cooler. Make sure there is plenty of ice in the cooler at all times.

4. MAINTENANCE

Not applicable.

5. PRECAUTIONS

5.1 INCIDENTAL ODORS

Note that although incidental odors should be noted in the logbook, it is unwise from a safety and health standpoint to routinely "sniff test" samples for contaminants.

5.2 DUPLICATE SAMPLE

No indication of which samples are duplicates is to be provided to the laboratory.

6. REFERENCES

U.S. Environmental Protection Agency. 1980. Interim Guidelines and Specifications for Preparing Quality Assurance Project Plans. QAMS-005/80.

 




Standard Operating Procedure No. 002 for Chain-of-Custody Form

Prepared by

EA Engineering, Science, and Technology, Inc., PBC 225 Schilling Circle, Suite 400 Hunt Valley, Maryland 21031



CONTENTS

		<u>Page</u>
1.	SCOPE AND APPLICATION	1
2.	MATERIALS	1
3.	PROCEDURE	1
4.	MAINTENANCE	1
5.	PRECAUTIONS	2
6.	REFERENCES	2



This page intentionally left blank



1. SCOPE AND APPLICATION

The purpose of this Standard Operating Procedure is to delineate protocols for use of the chain-of-custody form. An example is provided as Figure SOP002-1. Other formats with similar levels of detail are acceptable.

2. MATERIALS

The following materials may be required: chain-of-custody form and indelible ink pen.

3. PROCEDURE

- Give the site name and project name/number.
- Enter the sample identification code.
- Indicate the sampling dates for all samples.
- List the sampling times (military format) for all samples.
- Indicate "grab" or "composite" sample with an "X."
- Specify the sample location.
- Enter the total number of containers per cooler.
- List the analyses/container volume.
- Obtain the signature of sample team leader.
- State the carrier service and airbill number, analytical laboratory, and custody seal numbers.
- Sign, date, and time the "relinquished by" section.
- Upon completion of the form, retain the shipper copy, and affix the other copies to the inside of the sample cooler, in a zip-seal bag to protect from moisture, to be sent to the designated laboratory.

4. MAINTENANCE


Not applicable.



5. PRECAUTIONS

None.

6. REFERENCES

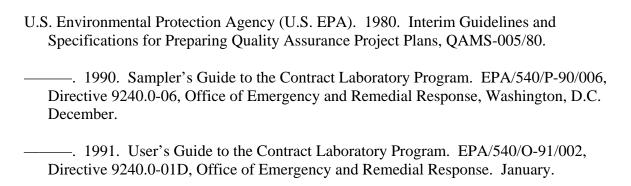



Company Name: Project Manager or		Parameters/Method Numbers for Analysis							nalys		Chain-of-Custody Record					
·				Contact: Phone:												® EA Laboratories 231 Schilling Circle Hunt Valley, MD 21031 Telephone: (410) 584-7000
Projec	t No			Project Name:												Telepriorie. (410) 564-7000
Dept.:		Tas	k:													
Samp	le Stora	ge Lo	catio	n: ATO Number:											Report Delivera	ables: 3 4 D E
Page	of		Rep	oort #:	ers										EDD: Yes/No	
					Containers										DUE TO CLIEN	Т:
Date	Time	Water	Soil	Sample Identification 19 Characters	No. of C										EA Labs Accession Number	Remarks
Date	1			XXXXXXXXXXXXXXXXXXX												LPM:
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX				\bot \bot \bot								
	1			XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX												
				XXXXXXXXXXXXXXXXXX		l T		\Box						1]		



Company Nam	ne:		Project Manage	er or			Parar	neters	/Meth	nod N	umber	s for	Anal	ysis				Chain-of-0	Custody Record	
, ,			Contact: Phone:														Y	® EA I 231 Hun	Laboratories Schilling Circle t Valley, MD 210 phone: (410) 584	
Project No.			Project Name:																()	
Dept.:	Tas	k:																		
Sample Stora			n: ATO Number:													Report 1	Delivera 2	bles: 3	4 D E	
Page of		Rep	ort #:		ers											EDD: `	Yes/No			
					Containers											DUE T	O CLIEN	Г:		
Data Time	Water	Soil	Sample Identi		No. of C											Acce	Labs ession nber		Remarks	
Date Time			19 Charac																	
			XXXXXXXXXXXXX																	
			XXXXXXXXXXXX																	
			XXXXXXXXXXXX																	
			XXXXXXXXXXXXX																	
			XXXXXXXXXXXXX																	
			XXXXXXXXXXXXX	XXXXXX																
			XXXXXXXXXXXXX	XXXXXX																
			XXXXXXXXXXXXX	XXXXXX																
			XXXXXXXXXXXXX																	
			XXXXXXXXXXXXX																	
			XXXXXXXXXXXXX																	
Samples by: (Signature) Date/Time					Reli	nquisl	ned b	y: (Si	gnatu	re)				Date	e/Time 		• ,	Signature)		Date/Time
Relinquished by: (Signature) Date/Time					Received by Laboratory: (Signature)					Date	e/Time	Airbill	Number:		Sample Shippe Fed Ex. Pur					
Cooler Temp.		C	pH: Yes N	No Comme	nts:						Custo	dy S	eals	Intact	Y	'es	No		Hand Carried	
			ethod number for an	alyses reques	ted.	This v	vill he	lp cla	rify an							ues.			Other:	

 




Standard Operating Procedure No. 004 for Sample Packing and Shipping

Prepared by

EA Engineering, Science, and Technology, Inc., PBC 225 Schilling Circle, Suite 400 Hunt Valley, Maryland 21031



CONTENTS

		<u>Page</u>
1.	SCOPE AND APPLICATION	1
2.	MATERIALS	1
3.	PROCEDURE	1
4.	MAINTENANCE	2
5.	PRECAUTIONS	2
6.	REFERENCES	2



This page intentionally left blank



1. SCOPE AND APPLICATION

The purpose of this Standard Operating Procedure (SOP) is to delineate protocols for the packing and shipping of samples to the laboratory for analysis.

2. MATERIALS

The following materials may be required:

Clear tape	Plastic garbage bags
Custody seals	Sample documentation
Ice	Waterproof coolers (hard plastic or metal)
Metal cans with friction-seal lids (e.g., paint cans)	Zip-seal plastic bags
Packing material ¹	

3. PROCEDURE

Check cap tightness and verify that clear tape covers label and encircles container. Wrap sample container in bubble wrap or closed cell foam sheets. Enclose each sample in a clear zip-seal plastic bag.

Place several layers of bubble wrap, or at least 1 in. of vermiculite on the bottom of the cooler. Line cooler with open garbage bag, place all the samples upright inside a garbage bag, and tie the bag.

Double bag and seal loose ice to prevent melting ice from soaking the packing material. Place the ice outside the garbage bags containing the samples.

Pack shipping containers with packing material (closed-cell foam, vermiculite, or bubble wrap). Place this packing material around the sample bottles or metal cans to avoid breakage during shipment.

Enclose all sample documentation (i.e., Field Parameter Forms, chain-of-custodies) in a waterproof plastic bag and tape the bag to the underside of the cooler lid. If more than one cooler is being used, each cooler will have its own documentation.

Seal the coolers with signed and dated custody seals so that if the cooler were opened, the custody seal would be broken. Place clear tape over the custody seal to prevent damage to the seal.

^{1.} Permissible packing materials are: (a) (non-absorbent) bubble wrap or closed cell foam packing sheets, or (b) (absorbent) vermiculite. Organic materials such as paper, wood shavings (excelsior), and cornstarch packing "peanuts" will not be used.



Refer to SOP Nos. 001, 002, 016, and 039.


Tape the cooler shut with packing tape over the hinges and place tape over the cooler drain. Ship all samples via overnight delivery on the same day they are collected if possible.

4. MAINTENANCE

Not applicable.

5. PRECAUTIONS

Any samples suspected to be of medium/high contaminant concentration or containing dioxin must be enclosed in a metal can with a clipped or sealable lid (e.g., similar to a paint can). Label the outer metal container with the sample number of the sample inside.

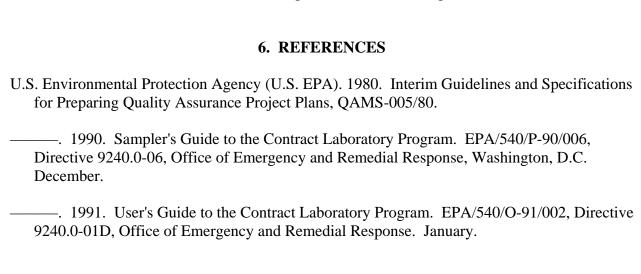






Standard Operating Procedure No. 005 for Field Decontamination

Prepared by

 EA Engineering, Science, and Technology, Inc., PBC 225 Schilling Circle, Suite 400 Hunt Valley, Maryland 21031



CONTENTS

	<u>Pag</u>	<u>e</u>
1.	SCOPE AND APPLICATION1	
2.	MATERIALS1	
3.	PROCEDURE1	
	3.1 Sample Bottles13.2 Personnel Decontamination13.3 Equipment Decontamination2	
	3.3.1 Water Samplers	
	3.3.1.1 Bailers 2 3.3.1.2 Pumps 2 3.3.1.3 Dip Samplers 3 3.3.1.4 Labware 3 3.3.1.5 Water Level Indicators 3	
	3.3.2 Solid Materials Samplers	
4.	MAINTENANCE6	
5.	PRECAUTIONS7	
6.	REFERENCES	



This page intentionally left blank



1. SCOPE AND APPLICATION

All personnel or equipment involved in intrusive sampling, or that enter a hazardous waste site during intrusive sampling, must be thoroughly decontaminated prior to leaving the site to minimize the spread of contamination and prevent adverse health effects. This Standard Operating Procedure describes the normal decontamination of sampling equipment and site personnel.

2. MATERIALS

The following materials may be required:

0.01N HCl	Non-phosphate laboratory detergent (liquinox)
0.10N nitric acid	Plastic garbage bags
Aluminum foil or clean plastic sheeting	Plastic sheeting, buckets, etc. to collect wash water and rinsates
Approved water	Pressure sprayer, rinse bottles, brushes
High performance liquid	Reagent grade alcohol ²
chromatography (HPLC)-grade water ¹	

3. PROCEDURE

3.1 SAMPLE BOTTLES

At the completion of each sampling activity, the exterior surfaces of the sample bottles must be decontaminated as follows:

- Ensure the bottle lids are on tight.
- Wipe the outside of the bottle with a paper towel to remove gross contamination.

3.2 PERSONNEL DECONTAMINATION

Review the project Health and Safety Plan for the appropriate decontamination procedures.

^{2.} For the purposes of this Standard Operating Procedure, the term "reagent grade alcohol" refers to either pesticide grade isopropanol or reagent grade methanol.



For the purposes of this Standard Operating Procedure, HPLC-grade water is considered equivalent to
"deionized ultra filtered water," "reagent-grade distilled water," and "deionized organic-free water." The end
product is water that is pure with no spurious ions or organics to contaminate the sample. The method of
generation is left to the individual contractor.

3.3 EQUIPMENT DECONTAMINATION

3.3.1 Water Samplers

3.3.1.1 Bailers

After each use, polytetrafluoroethelyne (PTFE) double check valve bailers used for groundwater sampling will be decontaminated as follows:

- Discard all ropes used in sampling in properly marked sealable container, or as directed by the Health and Safety Plan. NOTE: No tubing is to be used in conjunction with a bailer in collecting samples.
- Scrub the bailer to remove gross (visible) contamination, using appropriate brush(es), approved water, and non-phosphate detergent.
- Rinse off detergent three times with approved water.
- Rinse bailer with reagent grade alcohol.
- Rinse bailer three times with HPLC-grade water.
- Rinse bailer with 0.10N nitric acid solution.
- Rinse bailer three times with HPLC-grade water.
- Allow bailer to air dry.³
- Wrap bailer in aluminum foil or clean plastic sheeting, or store in a clean, dedicated polyvinyl chloride or PTFE storage container.
- Dispose of used decontamination solutions with drummed purge water.
- Rinse bailer with HPLC-grade water immediately prior to re-use.

3.3.1.2 Pumps

Submersible pumps will be decontaminated as follows:

^{3.} If the bailer has just been used for purging and is being decontaminated prior to sampling, do not air dry. Double rinse with HPLC-grade water and proceed to collect samples.



- Scrub the exterior of the pump to remove gross (visible) contamination, using appropriate brush(es), approved water, and non-phosphate detergent. (Steam cleaning may be substituted for detergent scrub.)
- Calculate the volume of pump plus any tubing which is not disposable and not dedicated to a single well. Pump three volumes of non-phosphate laboratory detergent solution to purge and clean the interior of the pump.
- Rinse by pumping no less than nine volumes of approved water to rinse.
- Rinse pump exterior with reagent grade alcohol.
- Rinse pump exterior with HPLC-grade water.
- Allow pump to air dry.
- Wrap pump in aluminum foil or clean plastic sheeting, or store in a clean, dedicated polyvinyl chloride or PTFE storage container.
- Prior to reusing pump rinse exterior again with HPLC-grade water. (Double rinse in Bullet 5 above may be substituted for this step).

3.3.1.3 Dip Samplers

All dip samplers, whether bucket, long-handled, or short-handled, will be decontaminated in the same manner as provided in Section 3.3.1.1.

3.3.1.4 Labware

Labware, such as beakers, which are used to hold samples for field measurements, water chemistry, etc., will be decontaminated according to the procedures in Section 3.3.1.1.

3.3.1.5 Water Level Indicators

Electric water level indicators, weighted measuring tapes, or piezometers used in the determination of water levels, well depths, and/or non-aqueous phase liquid levels will be decontaminated in accordance with Section 3.3.1.1. Clean laboratory wipes may be substituted for brushes. Tapes, probes, and piezometers should be wiped dry with clean laboratory wipes, and coiled on spools or clean plastic sheeting rather than allowed to air dry.

3.3.2 Solid Materials Samplers

Solid materials samplers include soil and sediment sampling probes, augers, trowels, shovels, sludge samplers, and other sampling equipment (e.g., core tubes, grab samples, core catchers, core liners, scoops, spoons, etc.), which will be decontaminated as follows:



- Scrub the sampler to remove gross (visible) contamination, using appropriate brush(es), approved water, and non-phosphate laboratory detergent.
- Rinse off detergent with approved water.
- Rinse sampler with reagent grade alcohol.
- Rinse sampler with HPLC-grade water.
- For non-metallic samplers only, rinse sampler with 0.10N nitric acid solution.
- For non-metallic samplers only, rinse sampler with HPLC-grade water.
- Allow sampler to air dry.
- Wrap sampler in aluminum foil clean plastic sheeting, or store in a new zipseal bag (size permitting) or clean, dedicated polyvinyl chloride or PTFE storage container.
- Dispose used decontamination solutions properly according to the site-specific Health and Safety Plan.
- Rinse sampler with HPLC-grade water immediately prior to re-use.

For larger sediment sampling equipment, if sediment can be collected from the interior of a sampling device and away from potentially contaminated surfaces of the sampler, a site water rinse may be sufficient between stations. A site water rinse may also be sufficient for vessel surfaces between sample locations. However, all tools and equipment coming into contact with the sample should be decontaminated in accordance with the procedures above. Wash water from decontamination activities should be collected and disposed of properly. Specific projects and programs may have additional decontamination requirements.

3.3.3 Other Sampling and Measurement Probes

Soil (or sediment) gas sampling probes will be decontaminated as solids sampling devices.

Temperature, pH, conductivity, redox, and dissolved oxygen probes will be decontaminated according to manufacturer's specifications. If no such specifications exist, remove gross contaminant and triple rinse probe with HPLC-grade water. A summary of the decontamination procedures to be used must be included in the instrument-specific standard operating procedure.

Measuring tapes that become contaminated through contact with soil or sediment during field use will be decontaminated as follows:



- Wipe tape with a clean cloth or laboratory wipe that has been soaked with non-phosphate laboratory detergent solution to remove gross contamination. Rinse cloth in the solution and continue wiping until tape is clean.
- Wipe tape with a second clean, wet cloth (or laboratory wipe) to remove soap residues.
- Dry tape with a third cloth (or laboratory wipe) and rewind into case, or re-coil tape.

3.3.4 Drilling Rigs, Sediment Sampling Vessels, and Other Heavy Equipment

All drilling rigs, sediment sampling vessels, and associated equipment such as augers, drill casing, rods, samplers, tools, recirculation tank, and water tank (inside and out) will be decontaminated prior to site entry after over-the-road mobilization and immediately upon departure from a site after drilling a hole. Supplementary cleaning will be performed prior to site entry when there is a likelihood that contamination has accumulated on tires and as spatter or dust enroute from one site to the next.

- Place contaminated equipment in an enclosure designed to contain all decontamination residues (water, sludge, etc.).
- Steam clean equipment until all dirt, mud, grease, asphaltic, bituminous, or other encrusting coating materials (with the exception of manufacturer-applied paint) have been removed.
- Water used will be taken from an approved source.
- Containerize in 55-gal drums; sample; characterize; and, based on sample results, dispose of all decontamination residues properly.

Other heavy equipment includes use of backhoes, excavators, skid steers, etc. If heavy equipment is utilized during field activities, i.e., a backhoe for test pitting, the bucket should not come in contact with soil to be sampled. If the bucket contacts the soil to be sampled, then it should be decontaminated between sample locations, following the same procedures as listed above for a drill rig.

3.3.5 High Performance Liquid Chromatography-Grade Water Storage

Dedicated glass storage containers will be used solely for dispensing HPLC-grade water. New HPLC-grade water containers will be decontaminated as follows:

- Clean with tap water from approved source and non-phosphate laboratory detergent while scrubbing the exterior and interior of the container with a stiff-bristled brush.
- Rinse thoroughly with approved water.



- Rinse with 0.01N nitric acid.
- Rinse with approved water.
- Rinse thoroughly with HPLC-grade water.
- Fill clean container with HPLC-grade water. Cap with one layer of PTFE-lined paper and one layer of aluminum foil. Secure cap with rubber band and date the container.

Used HPLC-grade water containers will be decontaminated as follows:

- Clean the exterior with tap water from an approved source, non-phosphate laboratory detergent, and a stiff-bristled brush.
- Rinse the exterior thoroughly with HPLC-grade water.
- Rinse the interior twice with pesticide-grade isopropanol.
- Rinse interior thoroughly with HPLC-grade water.
- Fill clean container with HPLC-grade water. Cap with one layer of PTFE-lined paper and one layer of aluminum foil. Secure cap with rubber band and date the container.

3.3.6 Ice Chests and Reusable Shipping Containers

- Scrub exterior/interior with approved brush and liquinox detergent.
- Rinse off detergent three times with approved water.
- Let air dry and properly store until re-use.

NOTE: If container/ice chest is severely contaminated, clean as thoroughly as possible, render unusable, and properly dispose.

4. MAINTENANCE

HPLC-grade water will be stored only in decontaminated glass containers with aluminum foil lids as stipulated above. The water may not be stored for more than nor used more than 3 days after manufacture.

HPLC-grade water will be manufactured onsite. An approved tap water source will be used as the influent to the system. Procedures for system setup, operation, and maintenance will conform to manufacturer's specifications.



5. PRECAUTIONS

Dispose of all wash water, rinse water, rinsates, and other sampling wastes (tubing, plastic sheeting, etc.) in properly marked, sealable containers, or as directed by the Health and Safety Plan.

Once a piece of equipment has been decontaminated, be careful to keep it in such condition until needed.

Do not eat, smoke, or drink onsite.

6. REFERENCES

Site-specific Health and Safety Plan.



This page intentionally left blank





Standard Operating Procedure No. 039 for Sample Preservation and Container Requirements

Prepared by

EA Engineering, Science, and Technology, Inc., PBC 225 Schilling Circle, Suite 400 Hunt Valley, Maryland 21031



CONTENTS

		<u>Page</u>
1.	PURPOSE AND SCOPE	1
2.	MATERIALS	1
3.	DEFINITION OF CONTAINER TYPES	1
4.	PROCEDURE	2
5.	MAINTENANCE	3
6.	PRECAUTIONS	3
7.	REFERENCES	3



This page intentionally left blank



1. PURPOSE AND SCOPE

The purpose of this Standard Operating Procedure (SOP) is to define the preservatives and techniques to be employed in preserving environmental samples between collection and analysis.

2. MATERIALS

The following materials may be required:

Containers (see Section 3 for description)	NaOH
HNO ₃	Ice chests
H ₂ SO ₄	Ice

3. DEFINITION OF CONTAINER TYPES

Listed below are the definitions of various container types.

Type	Container	Closure	Septum
A	80-ounce (oz) amber glass, ring handle bottle/jug, 38-millimeter (mm) neck finish	White polypropylene or black phenolic, baked polyethylene cap, 38-430 size, 0.015-mm polytetrafluoroethelyne (PTFE) liner	
В	40-mililiter (mL) glass vial, 24-mm neck finish	White polypropylene or black phenolic, open top, screw cap, 15-mm opening, 24-400 size	24-mm disc of 0.005- inch (in.) PTFE bonded to 0.120-in. silicon for total thickness of 0.125 in.
С	1-L high density polyethylene, cylinder-round bottle, 28-mm neck finish	White polyethylene cap, white ribbed, 28-410 size; F217 polyethylene liner	
D	120-mL wide mouth glass vial, 48-mm neck finish	White polyethylene cap, 40-480 size; 0.015-mm PTFE liner	
E	250-mL Boston round glass bottle	White polypropylene or black phenolic, open top, screw cap	Disc of 0.005-in. PTFE bonded to 0.120-in. silicon for total thickness of 0.125 in.
F	8-oz short, wide mouth, straight- sided, flint glass jar, 70-mm neck finish	White polypropylene or black phenolic, baked polyethylene cap, 48-400 size; 0.030-mm PTFE liner	
G	4-oz tall, wide mouth, straight - sided, flint glass jar, 48-mm neck finish	White polypropylene or black phenolic, baked polyethylene cap, 48-400 size; 0.015-mm PTFE liner	



Type	Container	Closure	Septum
H	1-L amber, Boston round, glass	White polypropylene or black	
	bottle, 33-mm pour-out neck finish	phenolic, baked polyethylene cap,	
		33-430 size; 0.015-mm PTFE liner	
K	4-L amber glass ring handle	White polypropylene or black	
	bottle/jug, 38-mm neck finish.	phenolic, baked polyethylene cap,	
		38-430 size; 0.015-mm PTFE liner	
L	500-mL high-density polyethylene,	White polypropylene, white	
	cylinder bottle, 28-mm neck finish	ribbed, 28-410 size; F217	

4. PROCEDURE

polyethylene liner

All containers described in Section 3 must be certified clean, with copies of laboratory certification furnished upon request. There may be circumstances when alternative containers will be used (e.g., aluminum foil around tissue samples placed in plastic bags, plastic buckets for large soil/sediment samples, etc.) for which laboratory certification may not be available. Such containering should be appropriately decontaminated or verified appropriately clean prior to using.

Water samples will be collected into pre-preserved containers appropriate to the intended analyte as given in Quality Assurance Project Plan. Samples taken for volatile organic compounds will be collected in accordance with SOP No. 003, Section 3.3.8. Samples taken for metals analysis will be verified in the field to a pH <2. The container should be tightly capped, then swirled to thoroughly mix the sample. The cap will then be loosened to release any excess pressure this operation may have generated. Samples taken for total phosphorous content will be verified in the field to a pH <2. The container should be tightly capped and swirled to thoroughly mix the sample. The cap will then be loosened to release any excess pressure this operation may have generated. Samples taken for cyanide will be verified for a pH >12. Most other samples do not require added preservation; however, there are analytes that may require special preservation, i.e., sulfide which requires a zinc acetate preservation. Preservation must be performed as documented in the project-specific Quality Assurance Project Plan. These samples will be immediately placed on ice and cooled to 4±2°C.

Soil and sediment samples will be collected into containers appropriate to the intended analyte as given in the Quality Assurance Project Plan. Samples taken for volatile organic compound analysis will collected in accordance with the site-specific SOP. Samples taken for metals analysis will be tightly capped, placed on ice, and maintained at a temperature of 4° C. Samples taken for total phosphorous content will be tightly capped, placed on ice, and maintained at a temperature of 4° C. Under most circumstances, no preservatives will be added to any other soil samples; follow project-specific requirements as documented in the Quality Assurance Project Plan. These samples will be immediately placed on ice and cooled to $4\pm2^{\circ}$ C.



5. MAINTENANCE

Not applicable.

6. PRECAUTIONS

Note that acidifying a sample containing cyanide may liberate HCN gas.

- Avoid breathing any fumes emanating from acidified samples.
- Acidify samples only in the open, rather than in closed spaces, i.e., a vehicle.
- Hold suspected HCN-generating sample away from body and downwind while manipulating it.
- See the Health and Safety Plan for other safety measures.

7. REFERENCES

U.S. Environmental Protection Agency (EPA). 1986. Test Methods for Evaluating Solid Waste SW-846.
. 1987. A Compendium of Superfund Field Operations Methods, EPA 540-P87-001.
——. 1991. A Compendium of ERT Soil Sampling and Surface Geophysics Procedures.



This page intentionally left blank

